

Service Issue Alert

Equipment: LDK6000 7" viewfinder


Problem : Picture is stretched vertically.

Description of Remedy: remove modification

Remedy: Remove cover to gain access to circuit board or right side of viewfinder. As shown below



Area of modification

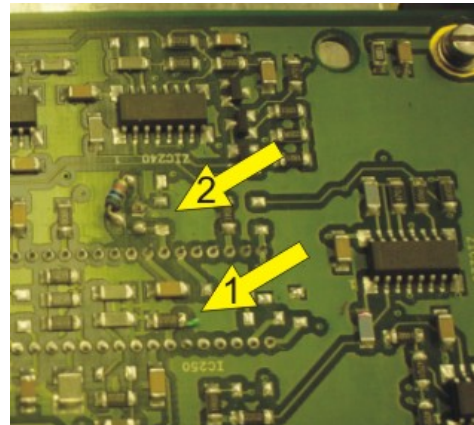

Remove green kynar wire at location 1
Remove transistor at location 2
Picture shows modification removed

*If the transistor or jumper is already removed and the problem persists, the problem is caused by another fault