

Field Modification Note

075063500

REFERENCE ECO: 156G

EFFECTIVITY DATE: SEPTEMBER 8, 2000

KALYPSO

2-M/E MAIN CONTROL PANEL (660-0005-00)

4-M/E MAIN CONTROL PANEL (660-0014-00)

Contacting Grass Valley Group

Region	Voice	Fax	Address	Web Site
North America	(800) 547-8949 530-478-4148	(530) 478-3347	Grass Valley Group P.O. Box 599000 Nevada City, CA 95959-7900 USA	www.grassvalleygroup.com
Pacific Operations	+852-2585-6688 Support: 852-2585-6579	+852-2802-2996		
U.K., Europe, Asia, Middle East	+44 1753 218 777	+44 1753 218 757		
France	+33 1 45 29 73 00			
Germany	+49 221 1791 234	+49 221 1791 235		

Copyright © Grass Valley Group. All rights reserved.

This document may not be copied, in whole or in part, or otherwise reproduced, except as specifically permitted under U.S. copyright law, without the prior written consent of Grass Valley Group, P.O. Box 599000, Nevada City, CA 95959-7900 USA. GRASS VALLEY GROUP is a registered trademark and Grass Valley is a trademark of Grass Valley Group. All registered trademarks and trademarks are property of their respective holders. Grass Valley Group products are covered by U.S. and foreign patents, issued and pending. Product options and specifications subject to change without notice. The information in this manual is furnished for informational use only, is subject to change without notice, and should not be construed as a commitment by Grass Valley Group. Grass Valley Group assumes no responsibility or liability for any errors or inaccuracies that may appear in this publication.

FMN 075063500

Kalypso 2-M/E Main Control Panel

Assembly Number: 660-0005-00, Versions A - P1

Kalypso 4-M/E Main Control Panel

Assembly Number: 660-0014-00, Versions A - N1

Purpose

This field modification corrects a problem with the SCSI cable connectors on the rear of the Kalypso 2-M/E and 4-M/E Main Control Panels. The screwlocks originally installed on the control panels' SCSI connectors are too long and may prevent SCSI cable connectors from securely mating with the corresponding panel connectors. This may in turn result in intermittent problems with the CD-ROM, Zip drive, or other devices in the SCSI chain. This field modification requires replacing the two screwlocks installed in the panel SCSI connector with the two new screwlocks provided. This will allow a secure cable connection and preclude any intermittent problems in the SCSI chain associated with an insecure cable connection at the panel.

Parts List

The parts provided for this modification are listed in Table 1.

Table 1. Parts List for FMN 075063500

Part Number	Description	Quantity
CF1890-00	Conn, Female Scrwlock Kit	2

Instructions

- **1.** Turn off power to the Kalypso control panel by opening the lid and turning off the power supplies.
- **2.** Locate the SCSI connector on the rear of the 2-M/E panel (Figure 1) or 4-M/E panel (Figure 2).

FMN 075063500 1

- **3.** Remove the SCSI cable by loosening the jackscrews holding it in place.
- **4.** Examine the screwlocks installed in the connector to determine if they are flush with the end of the connector. If the screwlocks extend beyond the end of the connector, the new screwlocks provided with this kit should be installed.
- **5.** Remove the existing screwlocks with a nut driver and install the new ones provided.

Note The screwlock kits provided include other hardware that is not necessary for this modification. Install just the new female screwlocks and discard the nut and washer included.

- **6.** Make sure the new screwlocks are flush with the SCSI connector and reinstall the SCSI cable. Verify that the cable connection is secure.
- **7.** Turn power back on to the control panel.

Figure 1. 2-M/E Control Panel SCSI Connector


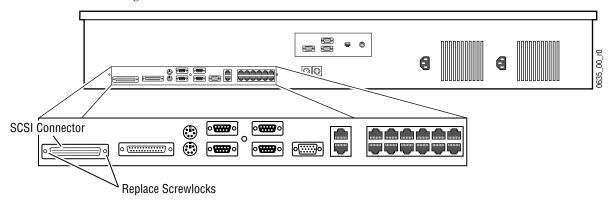


Figure 2. 4-M/E Control Panel SCSI Connector



2 FMN 075063500

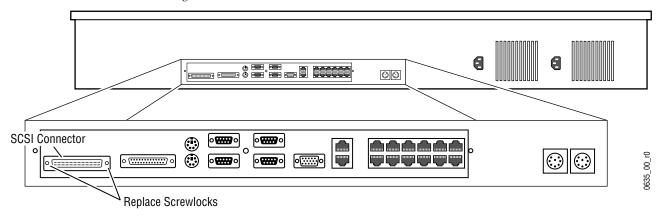

Grass Valley Group Headquarters P.O. Box 599000 Nevada City, CA 95959-7900

