

[Internal Use Only] <<The information in this document should not be used for other purpose than Sony and/or Sony authorized dealers (ASC/ASD).>>

Sony Corporation

No. HDCM14-040-TN

Technical News

Issued : June 17, 2014

Subject: Software Release [AT Software: V2.10]

[Applicable Model]

| Model / Destination | Serial Number | Number of Unit |
|---------------------|---------------|----------------|
| HDC1700 CED | | |
| HDC1700 E33 | | |
| HDC1700 JN4 | | |
| HDC1700 SYL | | |
| HDC2000 CED | | |
| HDC2000 J4 | | |
| HDC2000 JN3 | | |
| HDC2100 J4 | | |
| HDC2400 CED | | |
| HDC2400 E33 | | |
| HDC2400 JN4 | | |
| HDC2400 SYL | | |
| HDC2500 CED | | |
| HDC2500 E33 | | |
| HDC2500 JN4 | | |
| HDC2500 SYL | | |
| HDC2550 CED | | |
| HDC2550 UC7 | | |
| HDC2570 CED | | |
| HDC2570 UC7 | | |
| HDC2580 CNB | | |
| HDC2600 J4 | | |

[Description]

V2.10 is released in order to support added functions. Perform the version upgrade as necessary.

[Change Point]

<New function>

1. Support HDLA15000/1
Support HDLA1500/1 whose functions are improved in accordance with the rear panel of HDC2000.
2. Add PsF Audio Delay mode
Add Audio Delay mode in PsF format.

<Corrected function>

1. Add "RESET HOURS METER" to SERVICE2 menu
Moved from FACTORY menu
2. Correct V.LINE (vertical line compensation) function
Support compensation of the fine vertical line since the resolution of the vertical line compensation is improved
3. Add the status check of DPR2-PLD
Indicate "DPR2 NG" when the abnormal status such as the failure of the start-up

<Error correction>

1. Measure against the congesting of the command when connecting with CNU
Correct the drop of the response of controlling the camera by the congesting of the command when connecting with CNU
2. Correct the PinP operation when connecting with CNU
The main picture is indicated as PinP picture when connecting with CNU, the PinP picture periodically becomes the cropped image. This error is corrected.
3. Correct the indication on Network Trunk + Video.
Correct the error that the Network Trunk is indicated as Disable on the menu although it is effective, on Network Trunk + Video.
4. Correct the ECS function when the DISP is indicated in standalone operation.
Correct the error that the shutter speed in ECS mode could not be changed by the rotary switch.
5. Correct the freezing error when the USER MENU is displayed.
Correct the freezing error when the all items are hidden in the customized USER MENU.
6. Correct the mismatching between the read Operation file and the hardware switch
Correct the mismatching between the read Operation file and the hardware switch in case that the applicable setting of the Operation file exist as the hardware switch such as HDLA connection or Studio model.

[Preparation]

<Software file>

File name:

hdc2000_app.pkg - Software file

hdc2000_sy.pkg - PLD data for the SY-408 board

* Please contact to your local Sony's service office for obtaining the software files.

<Other>

USB memory 1 piece

[Installation Procedure]

For the work procedure, refer to the MAINTENANCE MANUAL.

[Confirmation/Adjustment]

Check the version of each item in the camera menu DIAGNOSIS – <ROM VERSION>(D3) page.

| | | |
|----------------------------------|-----------------------|-----------------|
| CAMERA APP V2.10 (Change target) | | |
| TG | V1.00 FIT | * HDC2600/2100 |
| TG | V2.00 IT | * HDC2500, etc. |
| TG | V2.00 L-IT | * HDC1700 |
| SY | V2.00 (Change target) | |
| DPR1 | V2.00 | |
| DPR2 | V1.20 | |
| SDI | V2.00 | |
| TR | V1.00 | |
| IF | V2.00 | |
| CD | V1.01 | |