



Camera

# Broadcast Products Technical Bulletin 20-2007-092

DATE: May 21, 2007

SUBJECT: AUDIO CLICKING NOISE

MODEL: *HDC1500//UL***DESCRIPTION**

Audio clicking noise may occur in MIC audio output.

SERIAL NO:

*HDC1500//UL 400,051–400,107*

If the jumper on the DAP-33 board (suffix -12) is attached to RB202 instead of RB201, reattach the jumper to RB201. (See Figure 1.)

*Italicized information in green applies to customers outside the United States.*

DAP-33 BOARD  
SUFFIX -12  
SIDE B, ZONE D-3

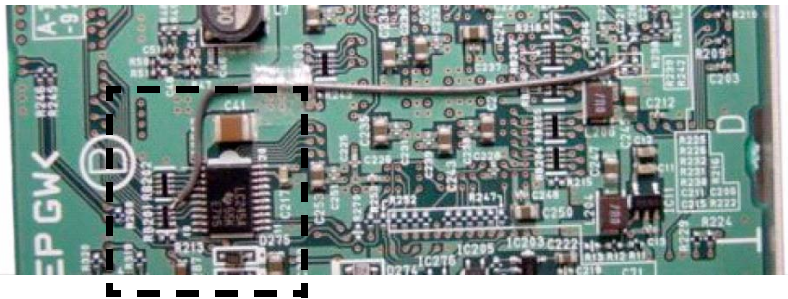


Figure 1

**CONFIRMATION**

Confirm that noise does not occur in MIC audio output.

HDVM06-143