



Broadcast Products Technical Bulletin 20-2010-115

DATE: August 9, 2010

SUBJECT: INTERCOM MICROPHONE REMAINS ON IN
STANDBY MODE

MODEL: **HDC1400//UL**
HDC1400/L
HDC1400/T
HDC1400/T
HDC1400R//UL
HDC1400R/L
HDC1400R/L1
HDC1400R/T
HDC1400R/T
HDC1400R/T1
HDC1400R/T1
HDC1400R=UL1
HDC1450//UF
HDC1450/K
HDC1450R//UF
HDC1450R/K
HDC1450R/K1
HDC1450R=UF1
HDC1500//UL
HDC1500/L
HDC1500/L
HDC1500/L1
HDC1500/L2
HDC1500/T
HDC1500/T2
HDC1500R//UL
HDC1500R/L
HDC1500R/L1
HDC1500R/T
HDC1500R/T
HDC1500R/T1
HDC1500R/T1
HDC1500R=UL1
HDC1550//UF
HDC1550//UF1
HDC1550/F
HDC1550/K
HDC1550/K1
HDC1550/K2
HDC1550R//UF
HDC1550R/K

DESCRIPTION

When HDLA1500 is connected, the intercom audio microphone may remain ON even when the camera is set to Standby mode (CAM POWER OFF) and the rear panel Intercom switch is set to MIC OFF. This symptom does not occur with CAM POWER ON.

PARTS REQUIRED

Part No.	Description	Qty.
1-208-927-11	Res, Chip, 1005, 47 kΩ	1

ORDERING INFORMATION

To order parts online, go to: www.sony.com/servicesplus. For service or parts ordering assistance, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 00-1999-000

MODIFICATION PROCEDURE**AU-298 Board (Side A, Zone B-1)**

Replace R82 (100 kΩ) with a new 47 kΩ resistor.

CONFIRMATION

Confirm that the side tone from the headset is OFF when the Intercom switch on the rear panel is set to OFF during Standby.

HDCM10-019

HDC1550R/K1
HDC1550R=UF1
HDC1580/L
HDC1580/L1
HDC1580/T
HDC1580R/L
HDC1580R/L1
HDC1580R/T
HDC1580R/T1

SERIAL NO: **ALL**

Italicized information in green applies to customers outside the United States.