

DENSITE-CPU-ETH2 Release Notes

FIRMWARE COMPATIBILITY MATRIX

Current Version	Desired Version			
	1xx	200,201,202	204,210,212	22X,23X
1xx	Use the file UPGRADE.zip	Use the file UPGRADE.zip	IMPOSSIBLE (1) Upgrade to version 200,201 or 202 first	IMPOSSIBLE (1) Upgrade to version 200,201 or 202 first
200,201,202		Use the file UPGRADE.zip	Use the file 7659-0102-204.img or 7659-0102-21x.bbbb.img	Use the file 7659-0102-22X.bbbb.img found in 7659-0102-22X.bbbb.tar.gz (2)
204,210,212		Use the file UPGRADE.zip	Use the file 7659-0102-204.img or 7659-0102-21x.bbbb.img	Use the file 7659-0102-22X.bbbb.img found in 7659-0102-22X.bbbb.tar.gz (2)
22x,23x		Use the file 7659-0102-2xx.img	Use the file 7659-0102-204.img or 7659-0102-21x.bbbb.img	Use the file 7659-0102-22X.bbbb.tar.gz or 7659-0102-23X.bbbb.tar.gz

(1) Starting from version 204 the folder "Self Upgrade Through Ethernet" which was used to do the upgrade using the "tftpd32.exe" tool, is not supported. A user who wants to go from a version 1xx to version 204 must first upgrade to version 200, 201 or 202.

(2) Starting from version 220, the 7659-0102-xxx.bbbb.img file is contained in a .tar.gz file. To extract the .img file from the .tar.gz you can use an application like 7zip (<http://www.7-zip.org/>)

WARNINGS

1. **LOSS OF DATA** when upgrading to v220 (or later) from v212 (or earlier)

During the upgrade of the CPU-ETH2 to version 220 (or later) from a version 212 (or earlier), all the restorable data of the cards saved on the CPU-ETH2 will be deleted. So once the Densité-CPU-ETH2 upgrade is complete all the restorable data of the cards should be re-saved to the CPU-ETH2. Please refer to the section '5.3.5 Topic – Data Restoration' of the CPU-ETH2 user manual.

2. **INCOMPATIBILITY** with **Modular multi-viewers**

The CPU-ETH2 needs to be at version 221 or later to be compatible with Kaleido-MX, Kaleido-Modular-X with Kaleido-X software earlier than 7.20

Make sure to upgrade the Kaleido-X software, on a Kaleido-MX or Kaleido-Modular-X multiviewer, BEFORE upgrading the Densité controller's CPU-ETH2 firmware to version 221 (or later). Earlier versions of the Kaleido-X software for the Kaleido-MX and Kaleido-Modular-X are not compatible with CPU-ETH2 version 220 (and later). Using a Kaleido-MX or Kaleido-Modular-X multiviewer that has a version of the Kaleido-X software earlier than 7.20, with a Densité controller that has version 220 or later of the CPU-ETH2 firmware, may result in an inoperative multiviewer system, in which case you might need assistance from Miranda Technical Support. Refer to Field Bulletin **Field-Bulletin_FB20140116-211** for more details.

3. **FIRMWARE UPDATE** takes a long time

When upgrading the software from a version less than 220 to a version of 220 or greater, the reboot process of the card may take several minutes. Please be patient (do not reset the card).

VERSION: 231

Release date: 2018-05-28

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-355	Fix for the DENSITE 3+ FR1 Chassis fan spurious rotor lock error detection

KNOWN BUGS & LIMITATIONS

Bug#	Description
	<p>Red flashing led and UPDATE FAILURE status message on front edge menu</p> <p>If an image, version ≥ 220, is ghosted on a Compact Flash and the Compact Flash is inserted in a controller that was at version ≥ 220 it's possible that the led of the controller starts flashing red and an error message: UPDATE FAILURE appears on the front edge menu. This error has no impact on the functionality of the controller.</p> <p><u>Workaround:</u> To get rid of the error message, upgrade the controller via the web page.</p>
	<p>Restore points backward incompatibility</p> <p>All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.</p>

VERSION: 230

Release date: 2018-04-17

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-346	Improve accuracy of time reported to cards in the frame In some situation the current time reported by the controller could be off by a couple of seconds.

KNOWN BUGS & LIMITATIONS

Bug#	Description
	Red flashing led and UPDATE FAILURE status message on front edge menu If an image, version >=220, is ghosted on a Compact Flash and the Compact Flash is inserted in a controller that was at version >=220 it's possible that the led of the controller starts flashing red and an error message: UPDATE FAILURE appears on the front edge menu. This error has no impact on the functionality of the controller. <u>Workaround:</u> To get rid of the error message, upgrade the controller via the web page.

	<p>Restore points backward incompatibility</p> <p>All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.</p>
--	--

VERSION: 229

Release date: 2017-06-27

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-338	Serial link between controller and cards shows 1x, and we expected 4x The KMX-I card serial link speed is reset to 1x because of a communication issue between the card and the controller.

KNOWN BUGS & LIMITATIONS

Bug#	Description
	Restore points backward incompatibility All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.

VERSION: 228

Release date: 2017-05-19

iControl compatibility: [4.42 and more](#)

iControl Solo compatibility: [4.42 and more](#)

RCP-200 compatibility: [Not Compatible](#)

Hardware incompatibility: [This firmware applies to all existing hardware assemblies.](#)

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-335	Controller reboots at regular interval when dhcp is enabled The controller was rebooting at a regular interval when dhcp was enabled and with KMX card present in the frame.

KNOWN BUGS & LIMITATIONS

Bug#	Description
	Restore points backward incompatibility All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.

VERSION: 227

Release date: 2017-04-03

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-333	Intermittently SNMP service on the Densite frames crashes. The Net-SNMP package was upgraded to the latest version which fixes the crash.

KNOWN BUGS & LIMITATIONS

Bug#	Description
	Restore points backward incompatibility All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.

VERSION: 225

Release date: 2016-10-11

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-328	CPU-ETH2 loses communication to iControl with more than 10 connections With version 2.0.4 and earlier the controller only accepted 10 connections. Since version 2.2.0 the controller accepts 32 connections but limits the number of connection that automatically receive unsolicited message to 4. Version 2.2.5 still accepts 32 connections but now all the connections will receive unsolicited message automatically.
ETH2-295	Handling of RAW data with slow clients / Lost of RAW data packets When multiple clients with widely varying bandwidth performance connect to the controller, there could be hick-ups in the handling of RAW data (for all clients). This mostly impacted the Fingerprint feature.
ETH2-300	Network Time Protocol Vulnerabilities The product was running the Network Time Protocol version 4.2.6p5 and therefore had some security vulnerabilities.

KNOWN BUGS & LIMITATIONS

Bug#	Description
------	-------------

	Restore points backward incompatibility
--	--

	<p>All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.</p>
--	--

VERSION: 223

Release date: 2014-10-17

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-294	Shellshock security vulnerability The product runs the Bash shell and thus has the Shellshock security vulnerability.

KNOWN BUGS & LIMITATIONS

Bug#	Description
ETH2-295	Handling of RAW data with slow clients When multiple clients with widely varying bandwidth performance connect to the controller, there could be hick-ups in the handling of RAW data (for all clients).
	Restore points backward incompatibility All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.

VERSION: 222

Release date: 2014-09-09

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-287 ETH2-194	Densite controller lost sync with NTP server after Ethernet switch is power reset The CPU-ETH2 NTP daemon would stop working when the switch on which it is connected was power reset.

KNOWN BUGS & LIMITATIONS

Bug#	Description
	Restore points backward incompatibility All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.

VERSION: 221

Release date: 2014-06-03

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.
See Firmware Compatibility Matrix for proper upgrade paths.

BUGFIXES

Bug#	Description
ETH2-283	Cannot activate option The 'Ethernet Link Redundancy Option' could not be activated if the activation key was starting with 00 (double zeros)
ETH2-290	MAC Address and MII Status are not correctly reported in the web page The MAC address and the MII status of eth1 are displayed for the eth2 interface.

KNOWN BUGS & LIMITATIONS

Bug#	Description
	Restore points backward incompatibility All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.

VERSION: 220

Release date: 2013-10-28

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

ENHANCEMENTS & NEW FEATURES

Ref#	Description
ETH2-105	Improved upgrade Upgrade is now more robust. Better feedback during upgrade.
ETH-124	Improve logging Debug log web page was improved to allow user to view logs directly on the web page.
ETH2-117	Performance enhancement

BUGFIXES

Bug#	Description
29876 (ETH2-84)	Changing DENSITE-CPU-ETH2 time causes the web server to crash When the time is changed on the controller, the web server starts using 99% of the CPU and after a couple of minutes it crashes.
ETH2-76	Bonding: good link/bad link not always correctly detected In active backup mode the link up/link down are not always correctly detected which

	prevents switch from one interface to the other.
ETH2-83	Densité MIB not available for download When attempting to follow the download link on the Web page, you get this message: > 404 Not Found > The requested URL '/densite.mib' was not found on this server.
ETH2-194	Densite controller booted without Ethernet connection doesn't sync with NTP server once connection is back When a Densite controller set to sync with a NTP server, is powered up with no Ethernet connection it doesn't sync with the NTP server once the Ethernet connection is re-establish.
ETH2-131	Speed up controller boot time The controller is slow to boot because of NTP initial synchronization.

KNOWN BUGS & LIMITATIONS

Bug#	Description
	Restore points backward incompatibility All previous restore points saved on the controller will be lost when upgrading from a firmware older than 220. A "save all" restore point must be executed manually by the user.

VERSION: 212

Release date: 2013-06-17

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

RCP-200 compatibility: Not Compatible

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.

See Firmware Compatibility Matrix for proper upgrade paths.

ENHANCEMENTS & NEW FEATURES

Ref#	Description
17161	Log activation per card Debug logging can now be enable card by card.
17162	Controller now accepts 32 connections The DENSITE-CPU-ETH2 now accepts up to 32 connections on its Ethernet port.
17163	Thumbnail streamed to all connections The DENSITE-CPU-ETH2 now can stream thumbnails to all its Ethernet connections.
26184	Ethernet connections listed on web page There is now a web page in the Status section that displays the list of connected device on the frame.
27479	Possible to delete restore point using the web page It's now possible to delete a saved restore point for a card using the Restore Points web page in the Tools section.
35643	Allow possibility for cards to save/load they restore point automatically It is now possible for a card to save/load its own restore point. This feature is only available on specific cards.

37839	Raw data (thumbnails) and unsolicited message filtering Device connected on the frame can now filter the raw data and unsolicited messages they want to receive. In the case of raw data, the connected device can filter based on raw data type and slot. In the case of unsolicited messages, the connected device can filter based on the slot.
23980	Increased communication speed between the controller and the cards This feature is only available on specific cards.

BUGFIXES

Bug#	Description
24081	Error message or incomprehensible message at the end of the upgrade At the end of the DENSITE-CPU-ETH2 upgrade a web page showing the result of the upgrade should be displayed but instead the user can see an error message because the web page is not accessible or worst a page full of garbage. In the first case this is because the web server was shut down for the reboot before the page could be served and in the second case the web page that should have been displayed was replaced during the upgrade by another file and it's this other file that is displayed. In both cases this doesn't affect the upgrade. To know if the upgrade was successful the user can wait about 30 seconds and attempt to reconnect to the DENSITE-CPU-ETH2 web page. Once connected, go back to the upgrade page and look at the version of the firmware installed. This error will be gone in the next upgrade from 211 to 2xx.
38005	Ethernet port does not start 3% of the time After a power up of the frame or after re-slotting the controller in the frame the Ethernet port does not work 3% of the time.
23812	Extra data in restore point of less than 1024 bytes Restore point of less than 1024 bytes were filled with zeros.

24283	<p>Very high memory usage when cards flood controller with messages</p> <p>The DENSITE-CPU-ETH2 was running out of memory when one or multiple cards were sending multiple unsolicited messages per second.</p> <p>The result was a dead controller. The only way to recuperate was to re-slot the controller.</p>
24983	<p>Card stuck in initialization</p> <p>Sometimes a card could be stuck in a state where it was waiting for a specific message from the controller and would not let the controller initialize it.</p>
28470	<p>Link Redundancy Option: Active-Backup: Ethernet not working at boot-up when only one Ethernet cable is connected</p> <p>At boot-up the network driver was not checking the state of the network interface.</p>
34485	<p>High CPU usage and crash when cards flood the controller with messages.</p> <p>The DENSITE-CPU-ETH2 was running at a very high CPU usage (> 90%) and after a while it was crashing when one or multiple cards where sending multiple unsolicited messages per second.</p> <p>The result was a reboot of the controller.</p>
36544	<p>NTP drift</p> <p>The time was drifting even if NTP was activated.</p>
38009	<p>Fixed security vulnerabilities</p> <p>Security vulnerabilities where fixed. The "FTP" server was removed. The "telnet" server was replaced by "ssh".</p>

KNOWN BUGS & LIMITATIONS

Bug#	Description
29876	<p>Changing DENSITE-CPU-ETH2 time causes the web server to crash</p> <p>When the time is changed on the controller, the web server start using 99% of the CPU and</p>

after a couple of minutes it crashes.

Workaround:

After changing the time, stop and restart the web server using the controller front panel menu.

VERSION: 211

Release date: 2014-10-17

iControl compatibility: 4.42 and more

iControl Solo compatibility: 4.42 and more

Hardware incompatibility: This firmware applies to all existing hardware assemblies.

See **WARNINGS** section at the top of this document.
See Firmware Compatibility Matrix for proper upgrade paths.

ENHANCEMENTS & NEW FEATURES

Ref#	Description

BUGFIXES

Bug#	Description
ETH2-294	Shellshock security vulnerability The product runs the Bash shell and thus has the Shellshock security vulnerability.

KNOWN BUGS & LIMITATIONS

Bug#	Description

VERSION: 210

Release date: 2012-09-20

See **WARNINGS** section at the top of this document.
See Firmware Compatibility Matrix for proper upgrade paths.

ENHANCEMENTS & NEW FEATURES

Ref#	Description
0001	Support of the new Densité 3 FR1 frame This is the first version of the CPU_ETH2 that supports the Densité 3 FR1 frame.

BUGFIXES

Bug#	Description

KNOWN BUGS & LIMITATIONS

Bug#	Description