

Kayak HD

DIGITAL PRODUCTION SWITCHER
WITH KAYENNE XL CONTROL PANEL

Release Notes Addendum

SOFTWARE VERSION 7.0.0

071847511
MAY 2009

Contacting Grass Valley

International Support Centers	France 24 x 7	+800 8080 2020 or +33 1 48 25 20 20 +800 8080 2020 or +33 1 48 25 20 20	United States/Canada 24 x 7	+1 800 547 8949 or +1 530 478 4148
Local Support Centers (available during normal business hours)	Asia	Hong Kong, Taiwan, Korea, Macau: +852 2531 3058 Indian Subcontinent: +91 22 24933476 Southeast Asia/Malaysia: +603 7805 3884 Southeast Asia/Singapore: +65 6379 1313 China: +861 0660 159 450 Japan: +81 3 5484 6868		
		Australia and New Zealand: +61 1300 721 495		Central/South America: +55 11 5509 3443
		Middle East: +971 4 299 64 40 Near East and Africa: +800 8080 2020 or +33 1 48 25 20 20		
	Europe	Belarus, Russia, Tadzikistan, Ukraine, Uzbekistan: +7 095 2580924 225 Switzerland: +41 1 487 80 02 S. Europe/Italy-Roma: +39 06 87 20 35 28 -Milan: +39 02 48 41 46 58 S. Europe/Spain: +34 91 512 03 50 Benelux/Belgium: +32 (0) 2 334 90 30 Benelux/Netherlands: +31 (0) 35 62 38 42 1 N. Europe: +45 45 96 88 70 Germany, Austria, Eastern Europe: +49 6150 104 444 UK, Ireland, Israel: +44 118 923 0499		

Copyright © Grass Valley. All rights reserved.

This product may be covered by one or more U.S. and foreign patents.

Grass Valley Web Site

The www.thomsongrassvalley.com web site offers the following:

Online User Documentation — Current versions of product catalogs, brochures, data sheets, ordering guides, planning guides, manuals, and release notes in .pdf format can be downloaded.

FAQ Database — Solutions to problems and troubleshooting efforts can be found by searching our Frequently Asked Questions (FAQ) database.

Software Downloads — Software updates, drivers, and patches can be downloaded.



END-OF-LIFE PRODUCT RECYCLING NOTICE

Grass Valley's innovation and excellence in product design also extends to the programs we've established to manage the recycling of our products. Grass Valley has developed a comprehensive end-of-life product take back program for recycle or disposal of end-of-life products. Our program meets the requirements of the European Union's WEEE Directive, the United States Environmental Protection Agency, and U.S. state and local agencies.

Grass Valley's end-of-life product take back program assures proper disposal by use of Best Available Technology. This program accepts any Grass Valley branded equipment. Upon request, a Certificate of Recycling or a Certificate of Destruction, depending on the ultimate disposition of the product, can be sent to the requester.

Grass Valley will be responsible for all costs associated with recycling and disposal, including freight. However, you are responsible for the removal of the equipment from your facility and packing the equipment to make it ready for pickup.



For further information on the Grass Valley product take back system please contact Grass Valley at + 800 80 80 20 20 or +33 1 48 25 20 20 from most other countries. In the U.S. and Canada please call 800-547-8949 or 530-478-4148, and ask to be connected to the EH&S Department. Additional information concerning the program can be found at: www.thomsongrassvalley.com/environment



Release Notes Addendum

Kayak HD

Software Issues Corrected in Release Version 7.0.0

Area	Description	ID
M/E Async	If you select the internal Color matte or Black in ME1 program and select on PP program bus the signal of M1C or M1D the Async button is blinking.	102096
Media Player	Record Button is missing for the MediaPlayers in the Sidepanel	102417
Mix Transition	The first add transition after recall of a special snapshot shows the border matte during transition	96964
Mix Transition	ADD Transition after 99Reset or Factory Default is corrupted.	99749
RAM Recorder	When transferring clips from RAM to USB, If you pull the USB prior to completing the transfer, the RamRec will delete the clip from the RAM.	88847
RAM Recorder	Recording a clip using Record ID mutes the audio payout for the clip.	90993
RamRec	"Move" a Clip/Still in RamRecorder Clips/Stills menu , causes a "Delete" of the target position when it's not an empty spot.	81402
Scalars	Center Cut selection is not available however the button is active.	96640
Software Compatibility	Installing or switching to an earlier software version may cause the system to automatically reboot. 1. This problem might occur when switching software versions between V7.0.0 and any other version. 2. The problem is fixed for the future releases when switching between V7.0.0 and any later version. NOTE: To recover from a locked state resulting from this problem, - Turn power off the video processor, - Remove the Controller module and turn off the battery, - Reinstall the Controller module and restart the switcher allowing it to boot up. - Power off the switcher - Remove the Controller module and turn the battery back on, - Reinstall the Controller module and restart the switcher.	
Wipes	The Speed as well as the Phase function on a modulated Wipe is missing.	99981

Known Restrictions

Area	Description	ID
Appli	An Appli name containing a special symbol (extended character) will cause a loss of data.	99008
Config	When using "Audio follow Video" the half M/E can't be selected in "Config/E-Box/Audio-Audio Settings".	81689
DPM	Performing a Factory Preset recalls DPM 0, but it should recall the system default values. Workaround: Store default values in DPM 0 on all M/E's available. Don't use DPM 0 for general effects.	62852
DPM	DPM auto run doesn't run the effect. It will only auto run if you manually rewind the effect. Workaround: Manually rewind the effect to autorun.	63368
DPM	When doing a DPM-Transition in TransPVW mode the opacity level (s) of included Keyer(s) are affected.	65060
DPM	In S-Linear, path is still being calculated as curve	67528
DPM	Cannot modify DPM path in Multi-channel effect.	75171
DPM	Montage with slab effects does not function properly.	83592
DPM	Modify All Absolute not working correctly in Recursives.	83805
DPM	Copying from an iDPM effect to the eDPM, 3D locate values for the Global Channel don't copy.	96745
E-Mem	E-MEM does not recall clips from media player. Workaround: It is possible to recall the clips from an external device by importing a Macro into the timeline. First program a Macro that loads a clip from an external device and test it to make sure it works. Second, create your timeline and import the contents of the Macro into the timeline. Currently you must use the Sidepanel for this workaround. Store the timeline, and the clip will be recalled in the effect.	62380
E-Mem	Wrong "Auto Aux PVW" source after E-Mem Recall when M/E('s) is set to "Permanent DSK PVW".	81158
E-Mem	A copied E-Mem register is empty if it is copied with the "Copy Config / Detailed" dialog on the side panel.	83170
eDPM / iDPM	Copy eDPM effect to iDPM doesn't include 3D locate values for the Global channel.	96745
Effects	The edges of the wipe pattern are per default to soft	54714
Effects	Wipe-shapes using maximum H+V modulation are popping In/Out at the start/end of a transition.	65064
Environment File	Input names including space are not recalled after environment is loaded from .ini file	99007
Flash Disk	Description of erasing effects from Flash 3 disk is misleading.	67607
Genlock	Install/Ebox/Timing: It's not possible to do a numerical input of the Genlock Phase.	102139
Kayenne XL Panel	Macro editing does not work for the Kayenne XL panel.	102149
Kayenne XL Panel	A USB keyboard doesn't work, even though it is detected.	102189
Kayenne XL Panel	With Selfkey the Fill bus shows no red tally if Matte Fill or Lin Key is selected.	102223
Kayenne XL Sidepanel	On the harddisc in a saved application the directory EDPM Effects will not shown even though it exists.	102152
Kayenne XL Sidepanel	It's not possible to select key 5 and 6 busses in the SidePanel.	102154
Key Memory	Key Memory doesn't work for Key 5+6.	102186
Keyers	The factory default for Keyer and E-MEM modes is "DD", not "Default". Workaround: After performing a factory reset, always set the Keyer and E-MEM modes to the preferred settings in the menu Install/Ebox/Misc.	83572
Keyframe	Modify All KF's doesn't work with Define MEMO.	72798
Keyframe	Montage mode is inaccurate when stamping on Keyframe	78609

Area	Description	ID
M/E	M/E couple does not support utility buses.	61954
MatteFill/Glow	Combining Matte Fill and Glow on a key can cause Noise in image.	71270
ME	When ME-H is copied to another ME, Keyer 5/6 and all MISC, which are not part of ME-H state, are copied.	104616
Odetics	Go To Timecode commands don't work with Profile under Odetics control.	85240
Ram Rec	RAM video flashes when recording stills in SD. The flash is not recorded!	71646
Ram Rec	Cannot reset the RamRec without losing Stills and Clips in memory.	71736
Ram Rec	RAM Recorder clips can't be played from E-MEM, unless a macro is created to play the clip and the macro is inserted in the effect.	77179
Ram Rec	Profile XP 1100 using Odetics Protocol. Neither Go To Timecode command from EMEM or from the Media Player menu will cue the Media Player.	85240
Ram Rec	Loading a still mutes the user control of audio.	86566
Ram Rec	Stills are not recalled correctly to Channels 2,4,6 if they were previously in vid/key mode.	86596
Ram Rec	Sometimes after doing a "Join Vid/Key" when the clip or still is loaded onto paired channels the video image is loaded into both channels. If you perform "Split Vid/Key" and then re-join them they will work correctly.	87110
Ram Rec	RamRec Audio has distortions on Panasonic Monitors (de-embedders).	87773
Ram Rec	Ram recorder does not record Audio in Record Edit mode.	88441
Ram Rec	In SD mode the Active Area is set to HD values.	93162
Router	Kayak router interface can not access all router inputs.	86544
Spektra Glow	Combining Matte Fill and Glow on a key can cause Noise in image. Adjust color difference to eliminate noise.	71270
Turbo	Turbo won't take cue commands in BVW mode.	77050
UMD	When displaying a M/E "PGM-OUT" of any M/E on a connected UMD, the Keyer status disappears when selecting another M/E PGM-Out in PGM-Bus of the UMD-monitored M/E.	81982
USB Flash Drive	If a USB flash drive is detected on a USB port during startup the Kayak Panel remains black. Workaround: Remove the USB flash drive and reboot the system by turning the power off and then back on.	63621

