



Switcher

Broadcast Products Technical Bulletin 20-2003-125

DATE: **June 9, 2003**SUBJECT: **SOFTWARE UPGRADE—VERSION 5.25**

MODEL: **BZS-7050A**
BZS-7060A
DVS-7250A

SERIAL NO: **ALL**

DESCRIPTION

Software version 5.25 is now available.

PARTS REQUIRED

Part No.	Description	Qty.
DS7060A15	DVS-7250A, BZS-7060A Software V5.25	1

ORDERING INFORMATION

To order upgrades, contact:

Sony **SOFTWAREPLUS®** Center**Fax: 816-880-6854****Call: 800-538-7550 → Option 5****Mail:** Sony **SOFTWAREPLUS®** Center

8281 NW 107th Terrace

Kansas City, MO 64153

Customers outside the United States: *Please order parts from your usual supplier.*

PROGRAM IMPROVEMENTS

Problems Corrected

- When pressing Proc Ctrl 2 with DME setup after choosing DME 1/2, the panel hung up.
- In KF, when Effect duration is set to "0," and Next KF/Prev KF was switched at a high speed, the switchers were all cleared.
- In a system with a redundant power supply, an abnormal power supply message was displayed. The algorithm to detect a momentary load change has been changed so that the message is displayed only when a continuous abnormality occurs.
- When issuing the duration attribute protocol from the axial editor to the DVS, the DVS processor was reset.
- When the Orthg button was selected in DME Ctrl, the Wipe Position Y parameter on the EL panel did not work in the downward direction.
- After copying between DME register channels from the switcher panel, the status display of No. 99 was the same as that of No. 98.

SWEM01-028

- When the DME was controlled from a switcher panel, power-up caused DME delegation in systems consisting of several DMEs.
- In the Disk menu, when the Effect register of the DME was called with the Shot Box function and the Run button was pressed, Effect was not executed.