

Technical Memo

Subject: DVS-7250 System, BZS-7050A/7060A Operating Software V5.26

Applicable Model(s)	(Destination)	Serial Number(s)	Number of Unit(s)
BZS-7050A	J	All	
BZS-7060A	E	All	

Index

1. Outline of BZS-7050A/7060A Software Change

1-1. Bug Fix

2. Parts Required for Version Upgrade

2-1. Floppy Disk for V5.26

3. Caution on Version Upgrade

3-1. Version Upgrade Procedure

3-2. Compatibility with former version

3-3. Caution on V5.26

4. Software Change History

The software released in this Technical Memo is the one which unifies several software released as a Beta version in the past. Therefore, unless any trouble on the system operation exists in these software, the version upgrade is not needed.

1. Outline of BZS-7050A/7060A Software Change

1-1. Bug Fix

1. In the system connecting the Router and the S-BUS via the BKDS-7000, when the cross-point of router was switched over with SNAP SHOT, the switch-over sometimes failed. (OLV7699)
2. In the state that the DME wipe was set to reverse, when switching the Transition Type in each M/E row from each state of MIX/NAM/WIPE to DME wipe, one frame of a DME picture before switching-over was left. (JPN4984)
3. In the state that the Next Transition was [KEY] and the Transition Type was [DME], when the [BKGD] of Next Transition and the [MIX] of Transition Type were pressed simultaneously, a picture of [DME] was momentarily outputted. (JPN4951)
4. In the system connecting the Router and the S-BUS via the BKDS-7000, when switched from the AUX bus panel of the switcher to the Router, if the specified cross-point (35, 37, 40, 41) was selected, the button tally did not light. (OLV8872)
5. When recalling the GPI timeline with SHOTBOX, the trigger set to GPI 5 to 8 was not outputted. (OLV9255)
6. When displaying more than 4 characters in the source name display area of panel, 2 characters at the top and 2 characters at the last were not correctly displayed in the M/E and P/P source name. (JPN7944)
7. When recalling the SNAP SHOT, an unwanted tally was momentarily outputted. (JPN7256)
8. When the Next Transition was changed from BKGD to KEY with the KY Modify, “On” and “Off” of Key were swapped in the KF hereafter. (OLV9511)

2. Parts Required for Version Upgrade

Use the following part.

Floppy disk for V5.26

2-1. Floppy Disk for V5.26

Floppy disks supplied with BZS-7050A/7060A

OPERATING PROGRAM 1	V5.26
OPERATING PROGRAM 2	V5.26

3. Caution on Version Upgrade

3-1. Version Upgrade Procedure

See the DVS-7250A Installation Manual.

3-2. Compatibility with former version

All of the snapshot, key-frame and setup created in the former version can be used.

3-3. Caution on V5.26

None

4. Software Change History

Rev Date	Tech memo No.	Version
'99-3	Official Release (SWEM99-023)	V5.00
'99-4	SWEM99-013	V5.01
'99-6	SWEM99-027	V5.02
'99-8	SWEM99-039	V5.03
'99-9	SWEM99-045	V5.11
'99-10	SWEM99-051	V5.12
'00-3	SWEM00-006	V5.20
'00-4	SWEM00-017	V5.21
'00-8	SWEM00-028	V5.23
'01-3	SWEM01-009	V5.24
'01-10	SWEM01-027	V5.25
'06-1	SWEM06-005	V5.26

* The software version can be seen in the INFORMATION menu of the SETUP menu.

After the version upgrade, confirm the version in it.