

## **Technical Bulletin**

No. 81-9059-0431-0 A

Page 1 of 1

Title: Audio Input Cable Connector Installation

Products: Lynx, RM4000, RM5000 Audio Routing Switchers

Date: March 29, 1999

## Issue:

Additional information is needed to install the audio input cable connectors for the products listed above.

## Solution:

Audio input cables are terminated with a 3-contact plug (PESA Part. No. 81-9029-0607-2) as shown in Figure 1. The connector contacts are not marked so the connector should be wired in accordance with Table 1.

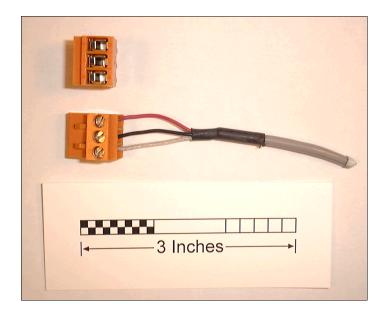


Figure 1. Audio Input Cable Connector Installation

Fig. 1 Position	Wire Color	Function
Top	Red	Audio High
Center	Black	Audio Low
Bottom	Shield	Shield

**Table 1. Connector Wiring**