



Winplus X-lite install Quick start Guide



Contents


- 1) X-lite box
- 2) CD with software
- 3) USB cable
- 4) Hand control HC 5/HC2
- 5) IEC to XLR power supply

It is highly recommended that you register your product with Autoscript, This will allow you to down load the latest version of Winplus.

sales@autoscript.tv

Note: You will need 'local administrator' rights to install Winplus

**Before Installing X-lite, run the setup program ualXXXX.exe
Or click on 'X-lite install' button on the CD front page.
This will insure that the latest drivers are available to you when you
install the hardware, the default install path is C:\Program
Files\Pciwplus32XL\USB XBOX Drivers.**

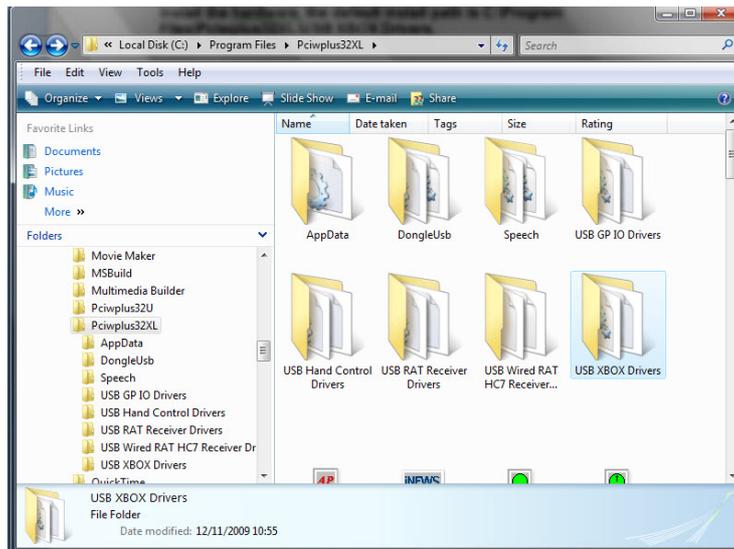

Path to X-lite driver folder

Installing the X-Lite

After running the setup program (as mentioned on Page 1) apply power to the X-lite with the included power supply XLR connection. Plug the USB cable into the computer and into the X-lite box.

The computer will detect the X-lite and start the add new hardware routine, choose manual install and browse too **C:\Program Files\Pciwplus32XL\USB XBOX Drivers** Windows XP will say these drivers are not approved by Microsoft, press continue.

Note: if 'automatic install' is selected with Windows XP, XP will install drivers for a USB hub, which will prevent Winplus from contacting the card.


If you do find yourself with this situation, you will need to go to 'device manager' and find a USB device with a yellow exclamation mark, double click on this and choose 're-install driver' and then browse to **C:\Program Files\Pciwplus32XL\USB XBOX Drivers** install should complete and Windows will


Tell you that your device is installed and ready to use.

USB Hand control install

If you have purchased a hand control with X-lite plug it in to a free USB port. Windows will detect it and pop up this window . **Fig 1**

Select 'not at this time' then click next

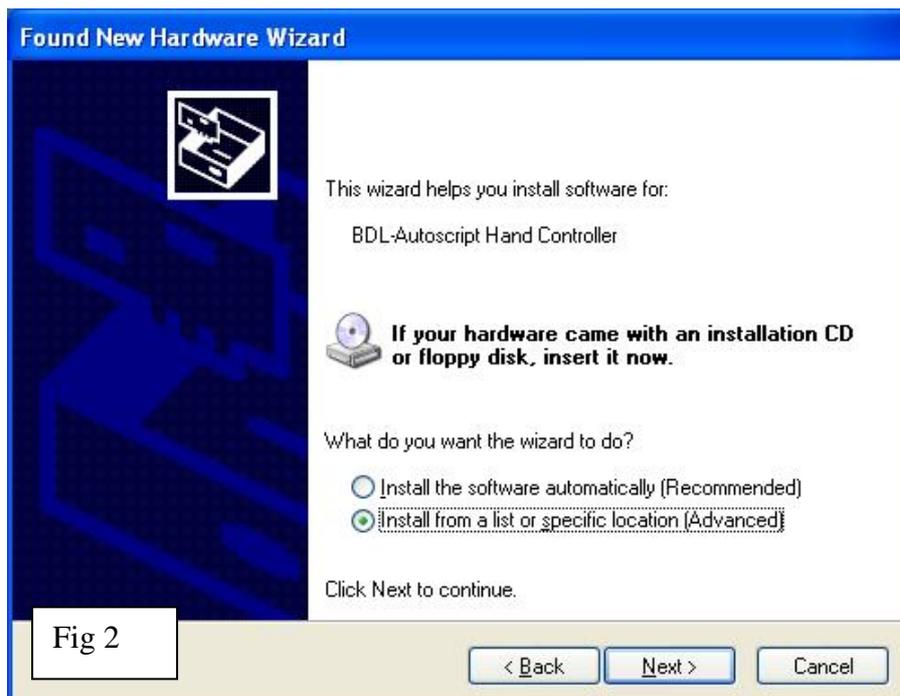

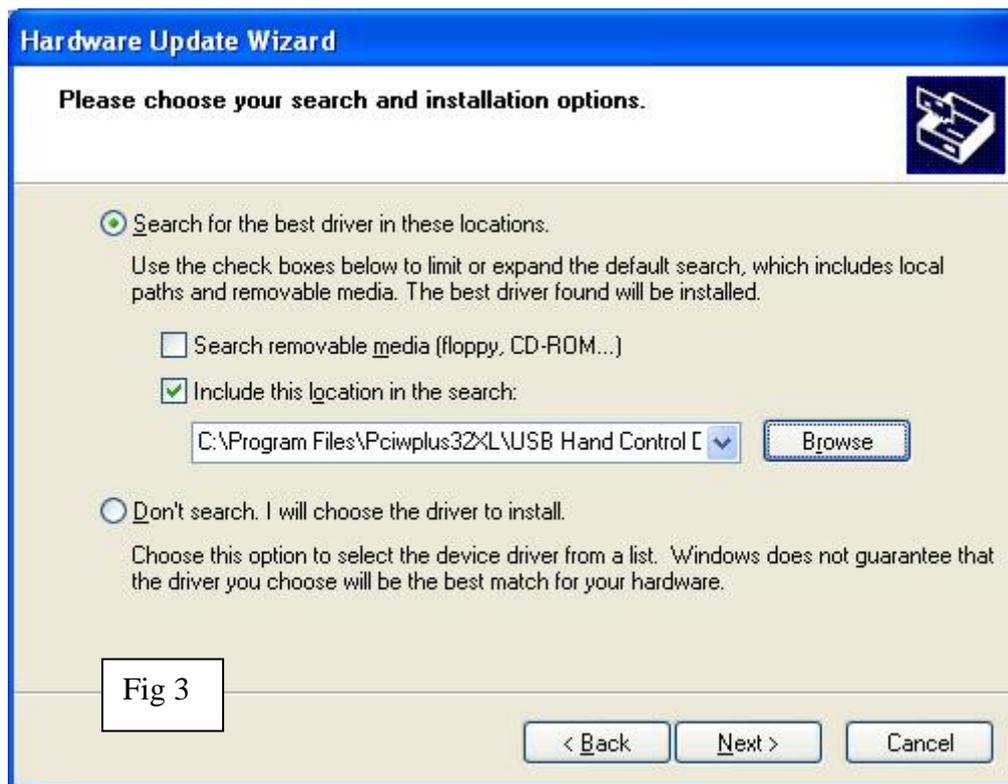

This screen will appear 'browse' to the home directory of Winplus
C:\Program Files\Pciwplus32XL\USB Hand Control Drivers
As shown in the screenshot **Fig 3**
Click next.

Note: Windows will go through this wizard twice once to install the USB hand control driver and a second time to install the serial to USB adapter (software only)

You now need to go to 'options\configuration then PCcard tab in Winplus to select the USB hand control.